

Duct	Unit	Type of Appliance	Appliance Defects	Pipework Defects	Flue Type	Flue Defects	Compartment Ventilation	Photograph No	NOC number
1	Unit 01	Bosch Hydro internal	None	None	Twin wall steel	Terminal to close to other terminals	1 x 200mm x 200mm in door	1 & 2	
	Unit 19	Bosch Hydro internal * NEW INSTALL 21/7/09* GF 006139 D Cairns	None	None	Twin Wall Steel	Flue touching PVC waste pipes - Termination too close to other terminals	1 x 200mm x 110mm in door	41,42,& 43	New Appliance NOC 1210089 SAP 300850814
	Unit 37	Old Valiant	No Casing	None	Twin wall steel	Flue termination to close to other terminals	1 x 200mm x 200mm in door	79 & 80	
2	Unit 02	Bosch Hydro internal	None	None	Twin Wall Steel	Terminal to close to other terminals	1 x 200mm x 110mm in door	3 & 4	
	Unit 20	Bosch Hydro internal * NEW INSTALL* No GF details	None	None	Twin wall steel/Asbestos cement	Existing Flue Undersized	1 x 200mm x 200mm in door	44	New appliance no Badge in Meter Box
	Unit 38	Old Valiant	Signs of sooting/poor combustion - poor access for service	None	Asbestos cement	Duct tape used on flue to seal a joints	1 x 200mm x 110mm in door	81,82 & 83	
3	Unit 03	Old Valiant	large yellow pilot flame	None	Asbestos cement	None	1 x 200mm x 110mm in door	5 & 6	
	Unit 21	No HWS fitted in duct	None	None	Asbestos cement	Old flue branch left uncapped	1 x 200mm x 110mm in door	45	
	Unit 39	Bosch Hydro internal	Poor access for service	None	Asbestos cement	Existing Flue Undersized	1 x 200mm x 110mm in door	84	
4	Unit 04	Old Valiant	large yellow pilot flame		Asbestos cement		1 x 200mm x 110mm in door	7 & 8	
	Unit 22	Old Valiant	Modifications/plate fixed over pilot viewing window	None	Asbestos cement	None	1 x 200mm x 200mm in door	46 & 47	
	Unit 40	Old Valiant	Signs of sooting/poor combustion - poor access for service	None	Asbestos cement	None	1 x 200mm x 110mm in door	85	
5	Unit 05	Internal EBF	Unable to view	15mm supply from meter	EBF	Original flue removed from duct	N/A	9	
	Unit 23	Bosch Hydro internal * NEW INSTALL 25/6/09* GF 008361 R Griffith	Unit fixed over water pipework - poor access for service - air vent into duct	15mm supply	Twin wall steel/Asbestos cement	Connection to asbestos flue not sealed on floor above - Existing Flue undersized	1 x 200mm x 110mm in door	48,49,50,51 & 52	New Appliance NOC 1068547 SAP 300843735
	Unit 41	Old Valiant	Signs of sooting/poor combustion - poor access for service	None	Asbestos cement	None	1 x 200mm x 200mm in door	86 & 87	
6	Unit 06	Bosch Hydro internal	None	None	Twin wall steel/Asbestos cement	Existing Flue Undersized	1 x 200mm x 110mm in door	10,11 & 12	
	Unit 24	Bosch Hydro internal			Twin Wall Steel	Flue bend on top of HWS - flue pipe installed in the wrong direction of flow - terminal to close to other terminals	1 x 200mm x 110mm in door	53,54 & 55	
	Unit 42	Old Pyrox	Poor access for service	None	Asbestos cement	Flue joints not adequately sealed	1 x 200mm x 110mm in door	88	
7	Unit 07	Bosch Hydro internal	Poor access for service	Part 15mm supply	Twin wall steel	Duct tape used on flue to seal a joint - flue pipe installed in the wrong direction of flow - Existing Flue undersized	1 x 200mm x 200mm in door	13,14 & 15	
	Unit 25	Bosch Hydro internal	Poor access for service	None	Asbestos cement	Existing Flue Undersized	1 x 200mm x 200mm in door	56	
	Unit 43	Bosch Hydro internal	Poor access for service	15mm supply	Twin wall steel/Asbestos cement	Flue joint not sealed- flue pipe installed in the wrong direction of flow - Existing Flue undersized	1 x 200mm x 110mm in door	89,90 & 91	
8	Unit 08	Old Valiant	large yellow pilot flame	None	Asbestos cement	Foil tape around flue	1 x 200mm x 110mm in door	16 & 17	
	Unit 26	Old Valiant	Signs of sooting/poor combustion - poor access for service	None	Asbestos cement	None	1 x 200mm x 110mm in door	57 & 58	
	Unit 44	Electric storage		Crimped cap	Asbestos cement	Flue branch with open end	1 x 200mm x 110mm in door	92	
9	Unit 09	Bosch Hydro internal	None	Part 15mm supply and Kinko fitting	Asbestos cement	Existing Flue Undersized	1 x 200mm x 200mm in door	18,19 & 20	
	Unit 27	Chaffoteaux	Poor access for service	15mm supply	Asbestos cement	Existing Flue Undersized	1 x 200mm x 200mm in door	59	
	Unit 45	No HWS fitted in duct		Crimped cap		Flue branch with open end	1 x 200mm x 110mm in door	93	

10	Unit 10	Electric storage		Crimped cap	Asbestos cement	None	1 x 200mm x 110mm in door	21 & 22	
	Unit 28	Electric storage		Crimped cap	Asbestos cement		1 x 200mm x 110mm in door	60	
	Unit 46	Vulcan Express	None	Part 15mm supply and Kinko fitting	Twin wall steel/Asbestos cement	Twin wall steel connected to Asbestos branch - Existing Flue undersized	1 x 200mm x 200mm in door	94 & 95	
11	Unit 11	Old Valiant	large yellow pilot flame	None	Asbestos cement	None	1 x 200mm x 200mm in door	23 & 24	
	Unit 29	internal * NEW INSTALL* No GF details	No casing fitted - poor access for service	15mm supply	Asbestos cement	Existing Flue Undersized - joints not properly sealed	1 x 200mm x 110mm in door	61 & 62	New appliance no Badge in Meter Box
	Unit 47	Old Valiant	Very poor access for service	None	Asbestos cement	Existing Flue Undersized - flue joints require sealing	1 x 200mm x 110mm in door	96	
12	Unit 12	Bosch Hydro internal	Poor access for service	15mm supply	Asbestos cement	Existing Flue Undersized	1 x 200mm x 110mm in door	25	
	Unit 30	Old Valiant	large yellow pilot flame	None	Asbestos cement	None	1 x 200mm x 110mm in door	63 & 64	
	Unit 48	Bosch Hydro internal	Very poor access for service	15mm supply	Twin wall steel/Flexi flue liner/Asbestos cement	90° bend on top of HWS - tape on flue joints - Existing flue undersized - existing flue joints not sealed	1 x 200mm x 110mm in door	97,98 & 99	
13	Unit 13	Old Valiant	None	None	Asbestos cement	None	1 x 200mm x 110mm in door	26	
	Unit 31	Old Valiant	None	None	Asbestos cement	None	1 x 200mm x 110mm in door	65	
	Unit 49	Bosch Hydro * NEW INSTALL 08* No GF details	No casing fitted - poor access for service	None	Asbestos cement	Existing Flue Undersized - joints not properly sealed	1 x 200mm x 200mm in door	108,109 & 110	New appliance no Badge in Meter Box
14	Unit 14	Electric storage		Crimped cap	Asbestos cement		1 x 200mm x 110mm in door	27	
	Unit 32	Electric storage		Crimped cap	Asbestos cement		1 x 200mm x 110mm in door	66	
	Unit 50	Old Valiant	large yellow pilot flame	None	Asbestos cement	None	1 x 200mm x 110mm in door	100 & 101	
15	Unit 15	Bosch Hydro *NEW INSTALL 7/8/09* GF011574 A Pascoe	Poor access for service - possible extract hose from laundry drier in duct	15mm supply	Asbestos cement	Existing Flue Undersized	1 x 200mm x 110mm in door	28,29 & 30	New Appliance NOC 1205838 SAP 300856759
	Unit 33	Bosch Hydro *NEW INSTALL 10* GF011574 P Dibb	Poor access for service	Part 15mm supply	Asbestos cement	Existing Flue Undersized and poorly repaired above HWS	1 x 200mm x 200mm in door	67,68,69,70 & 71	New Appliance NOC 1060264 Not yet logged in SAP as NOC returned to GF
	Unit 51	Bosch Hydro internal	Poor access for service	15mm supply	Asbestos cement	Existing Flue Undersized	1 x 200mm x 200mm in door	102 & 103	
16	Unit 16	Bosch Hydro internal *NEW INSTALL * No GF details	Poor access for service	None	Asbestos cement	Existing Flue Undersized - Flue mis-aligned and poorly repaired above HWS	1 x 200mm x 110mm in door	31,32 & 33	New pipework GF 002203 S Hayward, NOC 1347938
	Unit 34	Vulcan Express	Poor access for service	Part 15mm supply and crimped joint	Asbestos cement	Existing Flue Undersized - flue joints have slipped apart	1 x 200mm x 110mm in door	72,73 & 74	
	Unit 54	Bosch Hydro internal	Poor access for service	15mm supply	Twin wall steel/Asbestos cement	Existing Flue Undersized - joint not sealed	1 x 200mm x 110mm in door	106 & 107	
17	Unit 17	Bosch Hydro internal * NEW INSTALL* No GF details	None	None	Asbestos cement	Existing Flue Undersized - Old DDD from Valiant left in service	1 x 200mm x 110mm in door	34,35 & 36	New Cooker GF006139 D Cairns, NOC 1246136
	Unit 35	Bosch Hydro internal	Poor access for service	None	Twin wall steel/Asbestos cement	Flue joint not sealed- flue pipe installed in the wrong direction of flow - Existing Flue undersized	1 x 200mm x 110mm in door	75 & 76	
	Unit 53	No HWS fitted in duct		None	Asbestos cement	Flue branch with open end	1 x 200mm x 110mm in door	105	
18	Unit 18	Bosch Hydro internal * NEW INSTALL* No GF details	Poor access for service	15mm supply - Compression fitting brazed to pipe	Asbestos cement	Existing Flue Undersized - Old DDD from Valiant left in service - open flue branch above slipped and not connected	1 x 200mm x 110mm in door	37,38,39 & 40	New appliance no Badge in Meter Box
	Unit 36	Bosch Hydro internal	Poor access for service	Part 15mm supply	Twin wall steel/Asbestos cement	Existing Flue Undersized	1 x 200mm x 110mm in door	77 & 78	
	Unit 54	Bosch Hydro internal	Poor access for service	15mm supply	Twin wall steel/Asbestos cement	Existing Flue Undersized - joint not sealed	1 x 200mm x 110mm in door	106 & 107	